

TECHNICAL BULLETIN - DISCONNECTING THE ICE BANK FILL LINE

Title	DISCONNECTING THE ICE BANK
Date	2020-12-10
Author	OLIVIA SCHNEIDER
For Questions Contact	SUPPORT@BEVI.CO 1-866-704-2384

Description

The carbonator unit has a location labeled “Ice Bank Fill/Empty” that is used periodically during use (particularly installation); however, the line should be disconnected and plugged when not needed.



FAQs

- **Why does the tube need to be disconnected?**
 - For compliance with NSF18, this line needs to be disconnected
- **Which units need this performed on?**
 - This procedure needs to be performed on every V1.5 Unit
 - All other units (Countertops and V1's/V.75's) should be checked

Required Tools and Materials

- 3/8" Push to Connect Plug




Remediation Process

- Locate the "Ice Bank Fill/Empty" fitting and connecting tube on the carbonator (Note: It should be labeled and is in the same position on both standup and countertop units)



- Remove the red locking clip that secures the tubing to the specified fitting

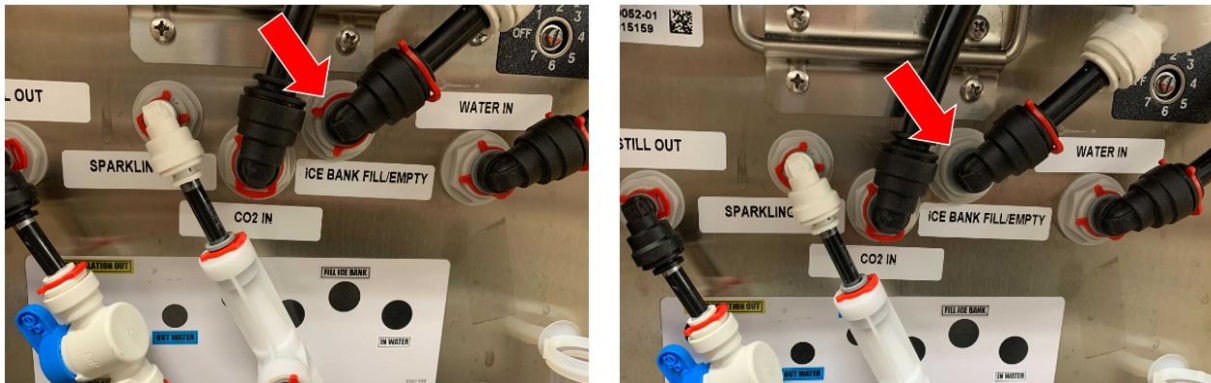

- Remove the tube from the push-to-connect fitting



- Plug the empty Ice Bank Fill port

